


Repair Parts Sheet

RC756, RC7513

Repair Parts Sheet	Revision	Revision Date	Product Code Beginning
Reference nr. L2807	Rev.A	02/2009	RC756: O RC7513: A

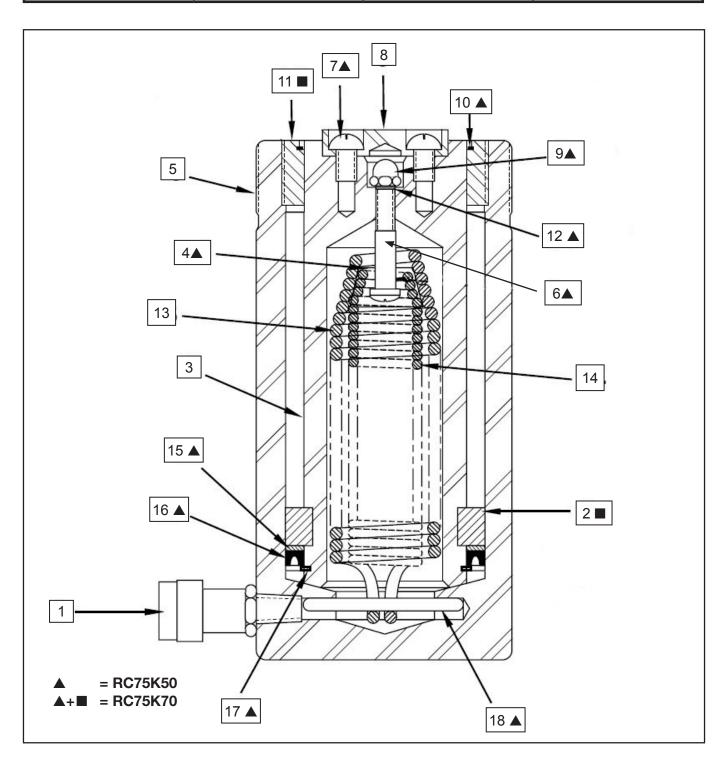

Repair Parts List			L 2807	
Item nr.	Qty	Description	RC756	RC7513
1	1	Coupler	CR400	CR400
2	1	Rod Bearing	•	
2	2	Rod Bearing		•
3	1	Plunger	Y834040	CH934040
4	1	Bushing	A	A
5	1	Cylinder base	Not serviceable, order a new cylinder	
6	1	Adjusting Screw	A	A
7	2	Screw	A	A
8	1	Saddle (includes 2x item 7)	L345045SR	L345045SR
9	1	Nut	A	A
10	1	Wiper Ring	A	A
11	1	Stop ring		
12	1	Gasket	A	A
13	1	External Spring	CN58110	
13	1	Spring		CJ247110
14	1	Internal Spring	CN59110	
15	1	Washer	A	A
16	1	U cup	A	A
17	1	Retaining Ring	A	A
18	1	Roll Pin	A	A
19	2	Eyebolt (not shown)		BSS6350D
20	1	Coupler O Ring (not shown)	A	A
21	1	Dust Cap (not shown)	A	A
22	1	Caution Decal (not shown)	A	A
23	1	Enerpac decal (not shown)	A	A

[■] Included in and available only as part of Repair Kit RC75K50.

^{■ =} Included in and available only as part of Repair Kit RC75K70. Bearing kit RC75K70 includes 1x RC75K50. Viton Repair Kit RC756KV = Item 10 & 16.



Item nr.	Torque / Remarks	
1	34 - 81 Nm 25 - 60 ft lbs	
1	Use Teflon tape or Loctite 545	
6	Firmly tighten screw to assure contact with plunger.	
9	20 - 24 Nm 15 - 18 ft lbs	
11	Secure with Loctite 222	
15	Washer to be placed with sharp edge towards U Cup	



To maintain your warranty, have your products inspected and repaired by an authorised Enerpac Service Centre

www.enerpac.com